

Identification of Blue Inclusions “Blue Dots”

For information applicable to KYDEX® FST please refer to 300 series technical briefs.

TB - 158


Introduction

Blue coloured inclusions, (blue dots,) occur on thermoformed KYDEX® thermoplastic sheet. This same phenomena occurs on ABS, polycarbonate and most other types of thermoplastics.

Blue dots are not visible on flat sheet. These inclusions only appear once the sheet is heated or thermoformed and are only found on the surface layer of the material. Typically, the intensity and size of the blue dots increase as more heat is applied during the forming process. Blue dots are most visible in light-coloured thermoformed parts, usually in the family of white colour.

Test Results

Independent laboratories identified the ‘blue dots’ as a blue dye, most likely from the Copper Phthalocyanine Blue family (Cu-Pc). This material is typically used as a colourant in inks, enamels, plastics, paints and textiles. Although KYDEX uses a Phthalo Blue pigment, none of the complaints for sheets with ‘blue dot inclusions’ have contained this type of colourant.

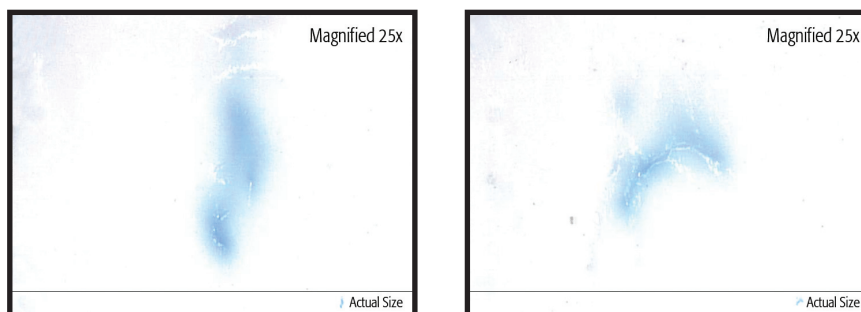

As illustrated in these images, blue dots typically have a “groove” associated with the blue colour. The colour is strongest closer to the groove and gradually fades as it expands away from the groove.

The cause of the blue dots is from fibers that have had intimate contact with the surface while the sheet is being heated for thermoforming. As the sheet is heated, the dye from the dark fibers transfers colour to the surface of the sheet. Further analysis has shown that fibers remaining after the thermoforming process, which have produced the grooves, are characteristic of cellulose (ex. cotton).

KYDEX, LLC

ISO 9001 and 14001 Certified

Customer Service

6685 Low St, Bloomsburg, PA 17815 USA
Phone: 800.325.3133, +1.570.389.5810
Outside the US: +1.570.389.5814
Fax: 800.452.0155, +1.570.387.7786
Email: info@kydex.com

Technical Service

Phone: 800.682.8758 ext. 581
Fax: +1.570.387.8722
Outside the US: +1.570.387.6997 ext. 581

www.kydex.com

Identification of Blue Inclusions “Blue Dots”

For information applicable to KYDEX® FST please refer to 300 series technical briefs.

TB - 158

Actions Taken

KYDEX has taken the following actions to minimize the occurrence of blue dots:

- 1) Change colour of production uniforms from blue to beige or white.
- 2) Replace coloured rags with white rags.
- 3) Quarantine the mezzanine from the extruders. A wall has been constructed on the mezzanine to minimize possible contamination from loose fibers or particles that may fall onto the surface of the sheet as it is processed by the texture rollers.

Summary

KYDEX has taken all the appropriate measures in-house during production to control fiber contamination. The environment of customers' facilities is beyond our control. We encourage our customers to minimize the possibility of blue dots by taking similar measures in their facilities.

In addition, we suggest that the unformed KYDEX® sheet be cleaned with an alcohol wipe before thermoforming. Thermoplastics can become statically charged, which makes it very difficult to remove all fibers without introducing new ones. An alcohol wipe will temporarily reduce the static charge, but recognize that not all fibers can be removed completely.

KYDEX Position

Based on the conclusions and analysis of independent testing laboratories, KYDEX has determined that blue dots are most likely to occur in areas outside of our control. Therefore, KYDEX will not extend credits or compensation for any blue dot complaints.

KYDEX, LLC

ISO 9001 and 14001 Certified

Customer Service

6685 Low St, Bloomsburg, PA 17815 USA
Phone: 800.325.3133, +1.570.389.5810
Outside the US: +1.570.389.5814
Fax: 800.452.0155, +1.570.387.7786
Email: info@kydex.com

Technical Service

Phone: 800.682.8758 ext. 581
Fax: +1.570.387.8722
Outside the US: +1.570.387.6997 ext. 581

www.kydex.com

Because we cannot anticipate or control the many different conditions under which this information and our products may be used, we do not guarantee the applicability of the accuracy of this information or the suitability of our products in any given situation. Users should conduct their own tests to determine the suitability of each product for their particular purposes. Data in the physical property table represents typical values and are to serve only as a guide for engineering design. Results are obtained from specimens under ideal laboratory conditions. Right to change physical properties as a result of technical progress is reserved. THE PRODUCTS DISCUSSED ARE SOLD WITHOUT WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE, EITHER EXPRESSED OR IMPLIED, EXCEPT AS PROVIDED IN OUR STANDARD TERMS AND CONDITIONS OF SALE. Buyer assumes all responsibility for loss or damage arising from the handling and use of our products, whether done in accordance with directions or not. In no event shall the supplier or the manufacturer be liable for incidental or consequential damages. Also, statements concerning the possible use of our products are not intended as recommendations to use our products in the infringement of any patent. Consult local code and regulatory agencies for specific requirements regarding code compliance, transporting, processing, recycling and disposal of our product. Product not intended for use as a heat resistant surface. Texture, product grade and other conditions may cause variations in appearance.

This information supersedes all previously published data.